



FAA Repair Station OA5R086N  
1675 Airport Road  
Waterford, MI 48327

Date 12/2/19  
W/O 18466

Reg. No .N204TV

SN. 10723  
Hours 1833.9

1. Complied with Annual/100 Hr. **Engine** inspections including 50/100 hour as per Robinson maintenance manual chapter 2 and FAR part 43 appendix D.
2. Aircraft records unavailable. Reviewed bi-weekly AD's through 2019-24.
3. Drained engine oil and removed filter. Installed new filter P/N CH48108- Serviced engine with 8 Qt's of Aeroshell 15W-50engine oil. Cut filter and inspected filter element. No defects were found. Work was performed in accordance with Robinson R-44 pilots handbook and Lycoming SB 480F.
4. Compression Test results as follows: Cyl. #1 60/80 Cyl. #2 64/80 Cyl. #3 60/80 Cyl. #4 72/80 Cyl. #5 67/80 Cyl. #6 70/80.
5. Post Annual Engine run was performed. Engine was leak checked, no defects noted.
6. No Flight checks as required by Robinson Maintenance Manual section 2.220 were performed. This Aircraft in not approved for return to service pending completion of required Flight checks.

The aircraft and/or component identified above was repaired and inspected in accordance with current Federal Aviation regulations and found to be not airworthy and is not approved for return to service.

OA5R086N

*Brendan D. Sping*